

INSPECTION REPORT

Product Description .: Garment -6 ITEMS	
	Report number .:
	Inspection Date.:
	Service Item .:
	<input checked="" type="checkbox"/> PSI <input type="checkbox"/> IPI <input type="checkbox"/> DPI <input type="checkbox"/> PM <input type="checkbox"/> FI <input type="checkbox"/> RE-PSI
	Customer .: Nordstrom
	Customer P.O .: /
	Vendor .: N/A
	Vendor P.O No .: N/A
	Target Market .: USA
	Manufacturer .: N/A
Location Area .: Hangzhou,Zhejiang	

Client P.O. #	Item No	Quantity on PO #		Actual Finished Quantity	
		Product Quantity	Cartons Quantity	Finished Quantity	Packed Cartons
/	NRD17-AD	804	9	804	7
	NR14-HD	804	9	804	7
	NR15-SP	804	9	/	/
	NR18-LI	804	9	20	0
	NR27-HL	804	9	600	3
	NRSH22AD	804	9	600	3
	NRSH44PP	804	9	20	0
Total		4620	54	2848	20

INSPECTION INFORMATION

Inspection based on					
<input type="checkbox"/> Approval Sample	<input checked="" type="checkbox"/> Specifications	<input checked="" type="checkbox"/> P/O#	<input type="checkbox"/> Photos	<input type="checkbox"/> Drawing	<input type="checkbox"/> Others.:

OVERALL INSPECTION RESULT	<input checked="" type="checkbox"/> FAIL Due to Over AQL&remark 1-7
----------------------------------	--

PROBLEMATIC REMARKS

1. Found the goods were not finished 100% the item
 2. For the ITEM NR14-HD, the warning word on the front on the product and some are slant.
 3. Please pay attention to the defects of untrimmed sewing thread and slant label. Details refer the AQL chart.
 4. The factory should add back stitching on the bottom seam of item NRD17-AD.
 5. The factory should pay attention to the untrimmed nylon thread
 6. Found there are no shine stone on the item NRD17-HD
 7. The factory is doing 6 styles there are no NR15-SP and add one style of short pants:NRSH22AD.
- Please see below attached photos to demonstrate the above Problematic Remarks:**



Remark 2:WARNIN G WORDS ON THE FRONT



Remark 4:NO BACK STITCH TO LOOSE STITCH




Remark 6:PO provided by client



Remark 6: actual product with no shine stone



Remark 5:NYLON THREAD

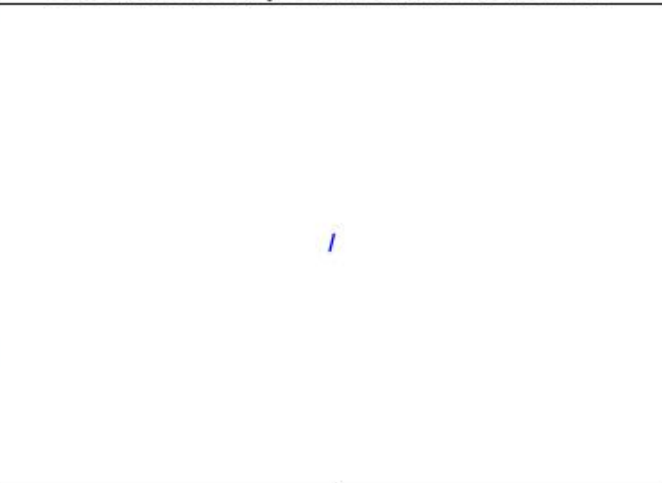

Client's Approval Samples Vs. Bulk Samples

Client's Approval samples' condition.:		
Client's Approval samples' condition.:	Yes/No	Inspector's Comments
Are the approval samples with client's label or hangtag?	No	/

Notice : This report is issued by the company under its General Conditions for inspection, assessment, technical assistance. The issuance of this report does not exonerate buyers or sellers from exercising all their rights and discharging all their liabilities under the contract of sales. Stipulations to the contrary are not binding on the company. The company's responsibility under this report is limited to proven negligence and will in no case be more than eight times the amount of the fees or commission, which will be paid by free Man-day.

Are the approval samples with client's hand-written signature, or chop?	No
---	----

INSPECTION METHODS APPLIED

Inspection Criteria - Acceptable Quality Level (AQL)			
Inspection service requirement	Final Random Inspection		
Sampling standard performed per	ANSI/ASQC Z1.4-1993 Single sampling plan for normal inspection (ISO 2859-1, MIL-STD 105E, or BS6001)		
General inspection levels at Acceptable Quality Level (AQL) for :	Critical	Major	Minor
	0	2.5	4.0
No. of sample size inspected for :	200	200	200
Total No. of packed cartons	/	cartons	Number of cartons open shall be the square root of the available cartons quantity.
No. of inspected cartons		cartons	
Samples selected from the following cartons :			
Comments.:	N/a		

APPEARANCE & FUNCTION INSPECTION

No.	NRD17-ND 50pcs Details of Non-Conformity	Critical	Major	Minor
Appearance & Visual Defects Item:				
1.	Needle hole	0	1	3
2.	Untrimmed sewing threads	0	0	3
3.	Slant label	0	0	1
Total defects found:		0	1	7
Samples Checked:		50	50	50
Inspection Result:		/		
No.	NR14-HD 50PCS Details of Non-Conformity	Critical	Major	Minor
Appearance & Visual Defects Item:				
4.	Untrimmed sewing thread	0	0	3
5.	Slant label	0	0	2
6.	Poor printing	0	1	2
Total defects found:		0	1	7
Samples Checked:		50	50	50
Inspection Result:		/		
No.	NR18-LI 10PCS Details of Non-Conformity	Critical	Major	Minor
Appearance & Visual Defects Item:				
7.	Untrimmed sewing thread	0	0	1
Total defects found:		0	0	1
Samples Checked:		10	10	10
Inspection Result:		/		
No.	NR27-HL 40PCS Details of Non-Conformity	Critical	Major	Minor
Appearance & Visual Defects Item:				
8.	Untrimmed sewing thread	0	0	1
Total defects found:		0	0	1
Samples Checked:		40	40	40
Inspection Result:		/		

No.	NRSH44PP 10PCS Details of Non-Conformity	Critical	Major	Minor
Appearance & Visual Defects Item:				
9.	Untrimmed sewing thread	0	0	5
10.	Slant label	0	0	3
11.	Poor hanger	0	0	1
12.	Needle hole	0	1	0
Total defects found:		0	0	9

Notice: This report is issued by the company under its General Conditions for inspection, assessment, technical assistance. The issuance of this report does not exonerate buyers or sellers from exercising all their rights and discharging all their liabilities under the contract of sales. Stipulations to the contrary are not binding on the company. The company's responsibility under this report is limited to proven negligence and will in no case be more than eight times the amount of the fees or commission, which will be paid by free Man-day.

Samples Checked:	10	10	10
Inspection Result:	/		

No.	NRSH22AD Short pants 10PCS Details of Non-Conformity	Critical	Major	Minor
Appearance & Visual Defects Item:				
13.	Untrimmed sewing thread	0	0	6
14.	Slant label	0	0	2
Total defects found:		0	0	8
Samples Checked:		40	40	40
Inspection Result:				
Maximum Critical/Major/Minor Allowed:		0	10	14
Defects found:		0	4	33
Samples Checked:		200	200	200
Inspection result		Beyond AQL		

Defect Photo :

1-defects-NR14-HD



Untrimmed sewing thread-minor

Untrimmed sewing thread-minor

Slant label-minor

Slant label-minor

Notice: This report is issued by the company under its General Conditions for inspection, assessment, technical assistance. The issuance of this report does not exonerate buyers or sellers from exercising all their rights and discharging all their liabilities under the contract of sales. Stipulations to the contrary are not binding on the company. The company's responsibility under this report is limited to proven negligence and will in no case be more than eight times the amount of the fees or commission, which will be paid by free Man-day.

<p>Untrimmed sewing thread-minor</p>	<p>Poor printing-major</p>
<p>Poor printing-minor</p>	<p>Poor printing-minor</p>
<p>2-defects-NR18-LI</p>	
	<p>/</p>
<p>Untrimmed sewing thread-minor</p>	<p>/</p>
<p>3-defects-NR27-HL</p>	



Untrimmed sewing thread-minor



4-defects-NRD17-AD



Untrimmed sewing threads-minor



Slant label-minor



Untrimmed sewing threads-minor



Untrimmed sewing threads-minor



Needle hole-minor



Needle hole-minor



Needle hole-minor



Needle hole-major

5-defects-NRSH22AD



Untrimmed sewing threads-minor



Untrimmed sewing threads-minor



Untrimmed sewing threads-minor



Untrimmed sewing threads-minor



Slant label-minor



Untrimmed sewing threads-minor



Untrimmed sewing threads-minor



Untrimmed sewing threads-minor

6-defects-NRSH44PP



Slant label-minor



Slant label-minor



Slant label-minor



Untrimmed sewing thread-minor



Needle hole-major



Untrimmed sewing thread-minor



Untrimmed sewing thread-minor



Untrimmed sewing thread-minor



Untrimmed sewing thread-minor



Poor hanger-minor

SPECIAL MADE CHECKLIST

Integrated in report bases on client's all of inspection requirements					Inspector Comments																																								
1. Quality Workmanship Audit A. Select sample size from the above chart B. If a style has multiple colors and PO/PI are issued by color, then the auditor can combine all PO/PI and conduct a combines audit C. If PO/PI has multiple colors, the sample size must be distributed proportionately across each color and size D. One Final Inspection report per PO/PI needs to be made EXAMPLE <table border="1" style="margin-left: 20px;"> <thead> <tr> <th>COLOR</th> <th>8</th> <th>10</th> <th>12</th> <th>14</th> <th>16</th> <th>18</th> <th>TOTA</th> </tr> </thead> <tbody> <tr> <td>RED</td> <td>60</td> <td>90</td> <td></td> <td>120</td> <td>90</td> <td>60</td> <td>570</td> </tr> </tbody> </table> <p>Sample size as per the above table will be 50</p> <p>Percentage of Sample = $50/570 \times 100$ equals 8.70% Therefore 8.7% of each size must be taken for auditing purpose Sample Qty for Size 8 would be $60 \times 8.7\% = 5.2$ or 5 pcs Sample Size Breakdown will be</p> <table border="1" style="margin-left: 20px;"> <thead> <tr> <th>COLOR</th> <th>8</th> <th>10</th> <th>12</th> <th>14</th> <th>16</th> <th>18</th> <th>TOTA</th> </tr> </thead> <tbody> <tr> <td>RED</td> <td>5</td> <td>8</td> <td>13</td> <td>10</td> <td>8</td> <td>6</td> <td>50</td> </tr> </tbody> </table>					COLOR	8	10	12	14	16	18	TOTA	RED	60	90		120	90	60	570	COLOR	8	10	12	14	16	18	TOTA	RED	5	8	13	10	8	6	50	<p>Complied, see relative section of report.</p>								
COLOR	8	10	12	14	16	18	TOTA																																						
RED	60	90		120	90	60	570																																						
COLOR	8	10	12	14	16	18	TOTA																																						
RED	5	8	13	10	8	6	50																																						
2. How to make sampling for inspected samples of appearance & workmanship, size measurement, cartons to open. <table border="1" style="width: 100%; margin-top: 10px;"> <thead> <tr> <th>Total Quantity</th> <th>Sample Size</th> <th>Measure</th> <th>Number of Cartons</th> <th>Units Audited per Carton</th> </tr> </thead> <tbody> <tr> <td>91-150</td> <td>20</td> <td>4 per Size</td> <td>3</td> <td>7</td> </tr> <tr> <td>151-200</td> <td>32</td> <td>4 per Size</td> <td>7</td> <td>5</td> </tr> <tr> <td>201-500</td> <td>50</td> <td>4 per Size</td> <td>10</td> <td>5</td> </tr> <tr> <td>501-1200</td> <td>80</td> <td>20</td> <td>16</td> <td>5</td> </tr> <tr> <td>1201-3200</td> <td>125</td> <td>32</td> <td>25</td> <td>5</td> </tr> <tr> <td>3201-10000</td> <td>200</td> <td>50</td> <td>40</td> <td>5</td> </tr> <tr> <td>10001-35000</td> <td>315</td> <td>50</td> <td>63</td> <td>5</td> </tr> </tbody> </table>					Total Quantity	Sample Size	Measure	Number of Cartons	Units Audited per Carton	91-150	20	4 per Size	3	7	151-200	32	4 per Size	7	5	201-500	50	4 per Size	10	5	501-1200	80	20	16	5	1201-3200	125	32	25	5	3201-10000	200	50	40	5	10001-35000	315	50	63	5	<p>Complied, see relative section of report.</p>
Total Quantity	Sample Size	Measure	Number of Cartons	Units Audited per Carton																																									
91-150	20	4 per Size	3	7																																									
151-200	32	4 per Size	7	5																																									
201-500	50	4 per Size	10	5																																									
501-1200	80	20	16	5																																									
1201-3200	125	32	25	5																																									
3201-10000	200	50	40	5																																									
10001-35000	315	50	63	5																																									
3. Size Measurement Audit a. Select sample size from the above chart b. Measure 1 pc per size on all point as indicated on graded spec c. Then measure the remaining sample lot for critical POMs d. If there are out of tolerance measurement on any non critical area, then the remaining sample lot must be measure at this area e. Based on accept/reject criteria, either use second sampling size or proceed to complete spec measurement audit f. 5 garments in sample size must be fitted and evaluated for fitting and balance if standard dress form is available at the vendors factory Use the Measurement Sheet to record all findings and attach it with the final inspection report					<p>Complied, see relative section of report.</p>																																								
4. Onsite Test.:					<p>Inspector Comments</p>																																								

Notice: This report is issued by the company under its General Conditions for inspection, assessment, technical assistance. The issuance of this report does not exonerate buyers or sellers from exercising all their rights and discharging all their liabilities under the contract of sales. Stipulations to the contrary are not binding on the company. The company's responsibility under this report is limited to proven negligence and will in no case be more than eight times the amount of the fees or commission, which will be paid by free Man-day.

<ul style="list-style-type: none"> - Carton drop test - Rub fastness & color fastness - Garment fitting test on dressform - Sharp edge test for Velcro/snap - Odor check - Heat transfer label check - Neck length - Color shading - Adhesive test on all marking/printing/logo - GSM test - Seam strength test 	Complied, see relative section of report.
--	---

ON-SITE TESTING

1.	On-site Testing Items	Sample size (PCS)	Result (PASS / FAIL / PEND)
	Carton Drop test	/	/
	Testing Conditions.:	Follow ISTA1 A Procedure as below.	
	Inspector Comments.:	/	
2.	On-site Testing Items	Sample size (PCS)	Result (PASS / FAIL / PEND)
	Rub Fastness & Color Fastness	8pcs	Passed
	Testing Conditions.:	RUB FASTNESS & COLOR FASTNESS to check the color fastness of the fabric and all the labels Method: Use white cotton cloth to rub the material Rub the item 10 times over a 10 cm distance with a force of 1 kg Test 1 pc per cloth with a dry and a wet cloth Expected Result: Dry Test: No greater than 4 on grey scale Wet Test: No greater than 3-4 on grey scale c	
	Inspector Comments.:	Found acceptable.	
3.	On-site Testing Items	Sample size (PCS)	Result (PASS / FAIL / PEND)
	Garment Fitting Test on Dress form	/	/
	Testing Conditions.:	If the factory has dress form available take 5 pcs of varying sizes and fit on dress form to check aesthetics, balance and fit	
	Inspector Comments.:	No dress form available	
4.	On-site Testing Items	Sample size (PCS)	Result (PASS / FAIL / PEND)
	Sharp Edge Test for Velcro/Snap	/	/
	Testing Conditions.:	If the garment under inspection has velcro/snap, QA must check this on entire sample size Method: Touch & Check if sharp edges is exposed Expected Result: No Sharp edge can be exposed.	
	Inspector Comments.:	No velcro/sanp	
5.	On-site Testing Items	Sample size (PCS)	Result (PASS / FAIL / PEND)
	Fatigue Test for Rivets/Velcro/Snap	/	/
	Testing Conditions.:	If the garment under inspection has rivet/velcro/snap, QA must check this Method: 1. 20 times Pull through rivets/velcro/snaps 2. For babywear, perform a pull test for button/snap (15 lbs for 10 secs) on 20 pcs Expected Result: It should be resistant.	
	Inspector Comments.:	/	
6.	On-site Testing Items	Sample size (PCS)	Result (PASS / FAIL / PEND)
	Odor Check	200pcs	Passed
	Testing Conditions.:	The products should not have any strong or offensive odor	
	Inspector Comments.:	Found acceptable.	
7.	On-site Testing Items	Sample size (PCS)	Result (PASS / FAIL / PEND)
	Heat Transfer label Check	8pcs	Passed
	Testing Conditions.:	If the garment under inspection has heat transfer label, QA must check this on entire sample size Check for.: 1. Label Position 2. Peel Off Easily 3. Pressing Mark	

Notice: This report is issued by the company under its General Conditions for inspection, assessment, technical assistance. The issuance of this report does not exonerate buyers or sellers from exercising all their rights and discharging all their liabilities under the contract of sales. Stipulations to the contrary are not binding on the company. The company's responsibility under this report is limited to proven negligence and will in no case be more than eight times the amount of the fees or commission, which will be paid by free Man-day.







	Inspector Comments.:	Found acceptable.		
8.	On-site Testing Items	Sample size (PCS)	Result (PASS / FAIL / PEND)	
	Neck Length	/	/	
	Testing Conditions.:	Check this on 5 pcs per size		
	Inspector Comments.:	/		
9.	On-site Testing Items	Sample size (PCS)	Result (PASS / FAIL / PEND)	
	Color Shading	200	Passed	
	Testing Conditions.:	1. Check Color shading within the same pc 2. Check color shading within different pcs of sample qty 3. Minimum grey scale 4-5 acceptable for color shading in same pc 4. Minimum Grey Scale 4 acceptable for color shading among different pcs		
	Inspector Comments.:	Fabric is not dyed /it;s printed		
10.	On-site Testing Items	Sample size (PCS)	Result (PASS / FAIL / PEND)	
	Adhesive test on all marking/printing/logo	10pcs	Passed	
	Testing Conditions.:	If the garment under inspection has marking/printing/logo check with an adhesive tape on 5 pcs for:Expected Result:Should not easily peel off		
	Inspector Comments.:			
11.	On-site Testing Items	Sample size (PCS)	Result (PASS / FAIL / PEND)	
	GSM Test	3pcs	Passed	
	Testing Conditions.:	For knits/sweater products conduct a GSM test and confirm that the fabric weight is as required This must be performed from 3 places on one sample or from bulk fabric available Mark weather the sample was ironed before the test Expected Result: Within +1-5% of the clients requirements is acceptable		
	Inspector Comments.:	The actual fabric is 179gsm.		
12.	On-site Testing Items	Sample size (PCS)	Result (PASS / FAIL / PEND)	
	Seam strength test	20	Pending	
	Testing Conditions.:	For knitted garments Pull the seams by hand with a tough force Check if there are any needle holes Perform this test on all seams for 20 pcs		
	Inspector Comments.:	Found 2 pcs there are needle hole		

ON-SITE TESTS (Photos)

1. Below photos to demonstrate the technique & process for certain on-site testing item.
2. For different products with the same testing item, only one photo will be taken as evidence.
3. It reflects the actual test result under the on-site testing condition provided, the testing result
4. can't be a documentary evidence for any disputes, for your reference only.



Notice: This report is issued by the company under its General Conditions for inspection, assessment, technical assistance. The issuance of this report does not exonerate buyers or sellers from exercising all their rights and discharging all their liabilities under the contract of sales. Stipulations to the contrary are not binding on the company. The company's responsibility under this report is limited to proven negligence and will in no case be more than eight times the amount of the fees or commission, which will be paid by free Man-day.

<p>Carton weight</p> 	<p>Carton weight</p> 
<p>Carton size</p> 	<p>Carton size</p> 
<p>Carton size</p> 	<p>Carton size</p> 



Pull test



Rub test




GSM test



Adhesion test



Adhesion test

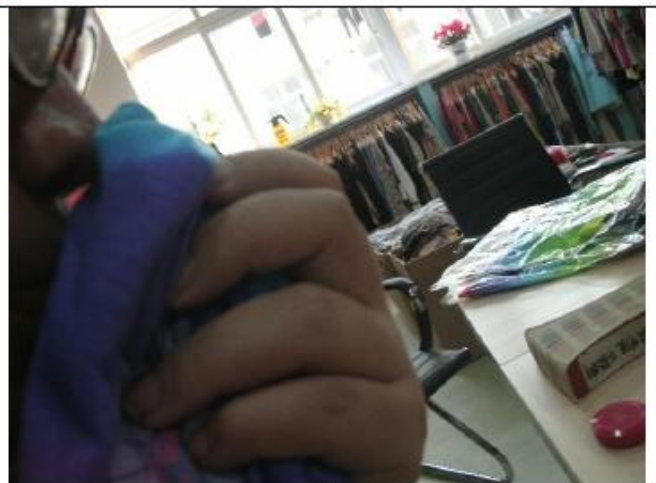

Smell test



Pull test



Color fastness



Pull test








Pull test



Pull test



Pull test

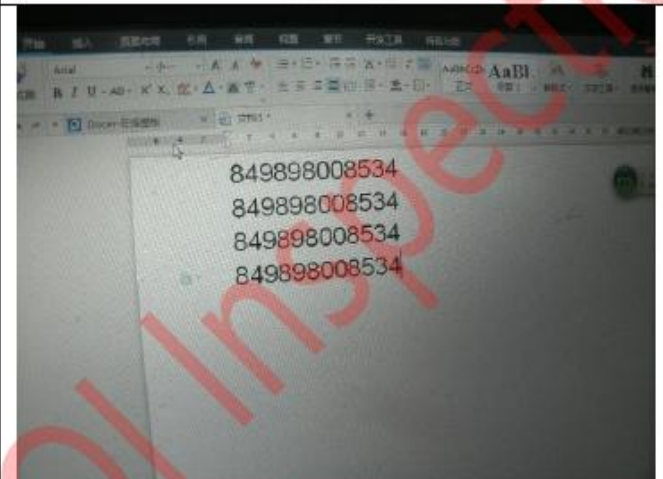	
<p>Pull test</p>	<p>Pull test</p>
	
<p>Adhesion test</p>	<p>Barcode scanning</p>
	<p>/</p>
<p>Barcode scanning</p>	<p>/</p>

GARMENT SIZE MEASUREMENT

Size Measurement



GEDC5670



GEDC5671



GEDC5676



GEDC5679



GEDC5680



GEDC5682



GEDC5683



GEDC5684



GEDC5686



GEDC5687



GEDC5691



GEDC5692



GEDC5693



GEDC5711



GEDC5712



GEDC5724



GEDC5725



GEDC5730



GEDC5731



GEDC5777



GEDC5778



GEDC5794



GEDC5795



GEDC5797



GEDC5800



GEDC5801



GEDC5834



GEDC5835



GEDC5836



GEDC5837



GEDC5838



GEDC5839



GEDC5840



GEDC5841



GEDC5842



GEDC5843



GEDC5844



GEDC5845



GEDC5846



GEDC5847



GEDC5848



GEDC5849



GEDC5850



GEDC5851



GEDC5852



GEDC5853



GEDC5854



GEDC5855



GEDC5856



GEDC5857



GEDC5858



GEDC5859



GEDC5860



GEDC5861



GEDC5862



GEDC5863



GEDC5864



GEDC5865



GEDC5866



GEDC5867



GEDC5868



GEDC5869



GEDC5870



GEDC5871



GEDC5872



GEDC5873



GEDC5874



GEDC5875



GEDC5876



GEDC5877



GEDC5878



GEDC5879



GEDC5880



GEDC5881



GEDC5882



GEDC5883



GEDC5884



GEDC5885



GEDC5886



GEDC5887



GEDC5888



GEDC5889



GEDC5890



GEDC5891



GEDC5892



GEDC5893




GEDC5894



GEDC5895



GEDC5896

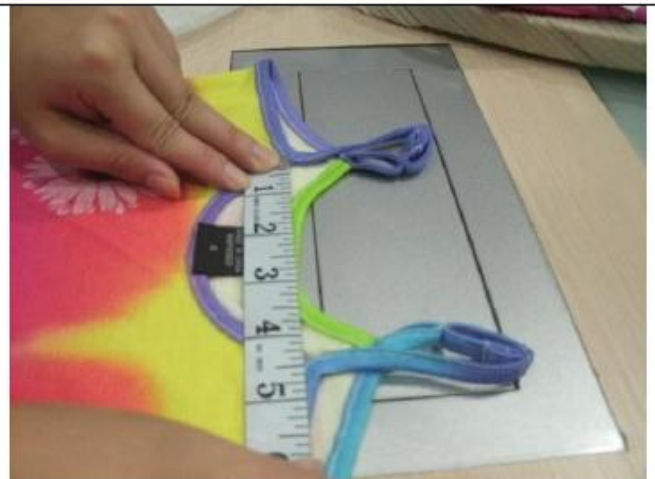

GEDC5897



GEDC5898



GEDC5899



GEDC5900



GEDC5901



GEDC5911



GEDC5912



GEDC5913



GEDC5914

Size Measurement

Remark.: if the size measurement point is out of tolerance, it will be highlighted with mark.

每款下抽6个尺寸量，一共测36件，超出±1/2的圈出来，拍照插入报告即可，谢谢。

NR14-HD										
Measure in Inches	4	5	6	6x	S	M	L	XL		
Point of measure:	4	5	6	6x	(7-8)	-10	-12	-14		
A length HSP to bottom	13 1/4	13 3/4	14 1/4	14 3/4	15 7/8	16 1/2	17 1/8	17 3/4		
B Chest 1" blwA/H	12 5/8	13	13 3/8	13 3/4	14 3/4	15 1/4	15 3/4	16 1/4		
C Bottom	13	13 1/2	14	14 1/2	15 1/2	16	16 1/2	17		
D A/H open Straight edge to edge	5 1/2	5 3/4	6	6 1/4	6 1/2	6 3/4	7	7 1/4		
E Across shoulder Edge to edge	10 1/2	11	11 1/2	12	13 1/8	13 3/4	14 3/8	15		
F Neck width Sm to sm	5 1/4	5 1/2	5 3/4	6	6 5/8	7	7 3/8	7 3/4		
G Front neck drop HSP to sm	2 7/8	3	3 1/8	3 1/4	3 1/2	3 5/8	3 3/4	3 7/8		
H Back neck drop HSP to sm	1 1/4	1 1/4	1 1/4	1 1/4	1 1/4	1 1/4	1 1/4	1 1/4		
I Neck Rib ht	5/8	5/8	5/8	5/8	5/8	5/8	5/8	5/8		
J Bottom hem ht	5/8	5/8	5/8	5/8	3/4	3/4	3/4	3/4		

NR15-SP										
Measure in Inches	4	5	6	6x	S	M	L	XL		
Point of measure:	4	5	6	6x	(7-8)	-10	-12	-14		
A Back length HSP to bottom	18 7/8	19.5	20.25	21	22.5	23.5	24.5	25.5		
B Front length HSP to bottom	14 1/4	15	15 3/4	16 1/2	18	19	20	21		
C Chest 1" blwA/H	12 3/8	12 3/4	13 1/8	13 1/2	14 1/4	14 3/4	15 1/4	15 3/4		
D Bottom	14	14 1/2	15	15 1/2	16 1/2	17	17 1/2	18		
E A/H open Straight edge to edge	5	5 1/4	5 1/2	5 3/4	6 3/8	6 3/4	7 1/8	7 1/2		
F Across shoulder Sm to Sm	8 3/4	9 1/4	9 3/4	10 1/4	11 3/8	12	12 5/8	13 1/4		
G Neck width Sm to sm	5 1/4	5 1/2	5 3/4	6	6 1/2	6 3/4	7	7 1/4		
H Front neck drop HSP to sm	2 3/4	3	3 1/4	3 1/2	3 3/4	4	4 1/4	4 1/2		
I Back neck drop HSP to sm	1	1	1	1	1 1/4	1 1/4	1 1/4	1 1/4		
J Neck Rib ht	1/2	1/2	1/2	1/2	5/8	5/8	5/8	5/8		
K A/H Rib ht	1/2	1/2	1/2	1/2	5/8	5/8	5/8	5/8		
L Bottom hem ht	5/8	5/8	5/8	5/8	5/8	5/8	5/8	5/8		

NR18-LI										
Measure in Inches	4	5	6	6x	7	s	M	L	XL	
Point of measure:	4	5	6	6x	7	(7-8)	-10	-12	-14	
A Back length HSP to bottom	18 3/4	19 1/2	20 1/4	21	21 3/4	22 1/2	23 1/2	24 1/2	25 1/2	
B Front length HSP to bottom	16	16 1/2	17	17 5/8	18 1/4	18 7/8	19 1/2	20 1/8	20 3/4	
C Chest 1" blwA/H	12 3/8	12 3/4	13 1/8	13 1/2	13 7/8	14 1/4	14 3/4	15 1/4	15 3/4	
D Bottom	17	17 1/2	18	18 1/2	19	19 1/2	20	20 1/2	21	

Notice: This report is issued by the company under its General Conditions for inspection, assessment, technical assistance. The issuance of this report does not exonerate buyers or sellers from exercising all their rights and discharging all their liabilities under the contract of sales. Stipulations to the contrary are not binding on the company. The company's responsibility under this report is limited to proven negligence and will in no case be more than eight times the amount of the fees or commission, which will be paid by free Man-day.

E	A/H open Straight edge to edge	5	$+1/8$	5 1/4	$+1/8$	5 1/2	$+1/8$	5 3/4	$+1/8$	6	6 3/8	6 3/4	7 1/8	7 1/2
F	Across shoulder Sm to Sm	8 5/8	$-1/8$	9	$+1/8$	9 3/8	$+1/8$	9 3/4	$+1/8$	10 1/8	10 1/2	11	$+1/8$	11 1/2
G	Neck width Sm to sm	5 1/4	$+1/4$	5 1/2	$+1/4$	5 3/4	$+1/4$	6	$+1/4$	6 1/4	6 1/2	6 3/4	7	7 1/4
H	Front neck drop HSP to sm	3		3		3 1/8		3 1/4		3 3/8	3 3/4	3 7/8	4	4 1/4
I	Back neck drop HSP to sm	3/4		3/4		3/4		3/4		3/4	1	1	1	1
J	Neck Rib ht	1/2		1/2		1/2		1/2		1/2	5/8	5/8	5/8	5/8
K	A/H Rib ht	1/2		1/2		1/2		1/2		1/2	5/8	5/8	5/8	5/8
L	Bottom hem ht	5/8		5/8		5/8		5/8		5/8	5/8	5/8	5/8	5/8

NR27-HL													
Measure in Inches	4	5	6	6x	(7-8)	M	L	XL					
A Full length HSP to bottom	18 3/8	19	19 5/8	20 1/4	21 1/2	22 1/8	22 3/4	23 3/8					
B Chest 1" blw A/H	12 3/8	12 3/4	13 1/8	13 1/2	14 1/4	14 5/8	15	15 3/8					
C Bottom	22 1/2	23	23 1/2	24	25	25 1/2	26	26 1/2					
D A/H open Straight edge to edge	5 3/4	6	6 1/4	6 1/2	7	7 1/4	7 1/2	7 3/4					
E shoulder width edge to edge	1 1/4	1 1/4	1 1/4	1 1/4	1 1/2	1 1/2	1 1/2	1 1/2					
F Neck width Edge to edge	5	5 1/4	5 1/2	5 3/4	6 1/4	6 1/2	6 3/4	7					
G Front neck drop HSP to Edge	3 3/4	4	4 1/4	4 1/2	5	5 1/4	5 1/2	5 3/4					
H Back neck drop HSP to edge	3/4	3/4	3/4	3/4	3/4	3/4	3/4	3/4					
I Neck Binding ht	1/4	1/4	1/4	1/4	1/4	1/4	1/4	1/4					
J A/H Binding ht	1/4	1/4	1/4	1/4	1/4	1/4	1/4	1/4					
K C-front raised at bottom	1 1/4	1 1/4	1 1/4	1 1/4	1 3/4	2	2 1/4	2 1/2					
L Bottom hem ht	3/8	3/8	3/8	3/8	3/8	3/8	3/8	3/8					

NRD17													
Measure in Inches	4	5	6	6x	(7-8)	M	L	XL					
A Full length HSP to bottom	18 3/8	19	19 5/8	20 1/4	21 1/2	22 1/8	22 3/4	23 3/8					
B Chest 1" blw A/H	12 3/8	12 3/4	13 1/8	13 1/2	14 1/4	14 5/8	15	15 3/8					
C Bottom	22 1/2	23	23 1/2	24	25	25 1/2	26	26 1/2					
D A/H open Straight edge to edge	5 3/4	6	6 1/4	6 1/2	7	7 1/4	7 1/2	7 3/4					
E shoulder width edge to edge	1 1/4	1 1/4	1 1/4	1 1/4	1 1/2	1 1/2	1 1/2	1 1/2					
F Neck width Edge to edge	5	5 1/4	5 1/2	5 3/4	6 1/4	6 1/2	6 3/4	7					
G Front neck drop HSP to Edge	3 3/4	4	4 1/4	4 1/2	5	5 1/4	5 1/2	5 3/4					
H Back neck drop HSP to edge	3/4	3/4	3/4	3/4	3/4	3/4	3/4	3/4					
I Neck Binding ht	1/4	1/4	1/4	1/4	1/4	1/4	1/4	1/4					

J	A/H Binding ht	1/4	1/4	1/4	1/4	1/4	1/4	1/4	1/4	1/4	1/4	1/4	1/4
K	C-front raised at bottom	1 1/4	1 1/4	1 1/4	1 1/4	1 3/4	2	2 1/4	2 1/2	2 1/2	2 1/2	2 1/2	2 1/2
L	Bottom hem ht	3/8	3/8	3/8	3/8	3/8	3/8	3/8	3/8	3/8	3/8	3/8	3/8

NRSH44PP													
Measure in Inches	4	5	6	6x	(7-8)	M	L	XL					
A 1/2 waist Relaxed	9	9 1/2	10	10 1/2	11 1/2	12	12 1/2	13					
B 1/2 waist Stretched	13 1/8	13 1/2	13 7/8	14 1/4	14 1/2	15	15 1/2	16					
C W/band Ht	1 1/2	1 1/2	1 1/2	1 1/2	1 1/2	1 1/2	1 1/2	1 1/2					
D Hip psn From crotch seam	3 1/2	3 1/2	3 1/2	3 1/2	3 1/2	3 1/2	3 1/2	3 1/2					
E Hip line	14 1/8	14 1/2	14 7/8	15 1/4	15 1/2	16 1/2	17	17 1/2	18				
F Thigh 1" below crotch	8 7/8	8 1/2	8 7/8	9 1/4	9 1/2	10	10 1/2	11					
G Leg open	7 5/8	8	8 3/8	8 3/4	9 1/8	9 1/2	10	10 1/2	11				
H Front rise Incl W/band	6 3/4	7	7 1/4	7 1/2	8 1/8	8 1/2	8 7/8	9 1/4					
I Back rise Incl W/Band	9	8 3/4	9	9 1/4	9 3/4	10 1/2	10 3/4	11					
J In-seam	2	2	2 1/4	2 1/4	2 3/4	3	3 1/4	3 1/2					
K Binding width	3/8	3/8	3/8	3/8	3/8	3/8	3/8	3/8					

工厂签字: *EIata* 质检员签字: *Mansur*
日期: 2015/02/10

PACKAGING DETAILS

1.	Shipping mark:	<input type="checkbox"/> Correct	<input type="checkbox"/> Incorrect	<input checked="" type="checkbox"/> N/A			
2.	Carton Information:	Color of carton	Brown	Corrugated Paper	<input checked="" type="checkbox"/> 5-Ply	<input type="checkbox"/> 7-Ply	
3.		Strength of carton	<input type="checkbox"/> Good	<input checked="" type="checkbox"/> Average	<input type="checkbox"/> Poor	<input type="checkbox"/> Other	
4.	How Many Pcs,Set / carton	Outer Carton	46	Pcs/Set	Inner Carton	1	Pcs/Set
5.	Packing material:	<input type="checkbox"/> Color box	<input type="checkbox"/> Corrugated case	<input type="checkbox"/> Bubble bag	<input checked="" type="checkbox"/> Poly-bag		
Remark.: please refer to the below photos for marking & labeling & packing for details.							
6.	Anti-cutting protection:	<input checked="" type="checkbox"/> OK	<input type="checkbox"/> Not good	<input type="checkbox"/> N/A			

Notice: This report is issued by the company under its General Conditions for inspection, assessment, technical assistance. The issuance of this report does not exonerate buyers or sellers from exercising all their rights and discharging all their liabilities under the contract of sales. Stipulations to the contrary are not binding on the company. The company's responsibility under this report is limited to proven negligence and will in no case be more than eight times the amount of the fees or commission, which will be paid by free Man-day.

7.	Carton Security Method:	<input type="checkbox"/> Carton staples <input type="checkbox"/> Glue <input checked="" type="checkbox"/> Nylon band <input type="checkbox"/> Carton Metal band
8.	Recycle Symbol:	TYPE: <input type="checkbox"/> Green dot symbol <input type="checkbox"/> Recycle logo
		ON: <input type="checkbox"/> Outer carton <input type="checkbox"/> Inner carton <input type="checkbox"/> Color box <input type="checkbox"/> Poly-bag <input type="checkbox"/> Other
9.	Language:	<input checked="" type="checkbox"/> English <input type="checkbox"/> See photos attached
10.	Country of origin:	<input checked="" type="checkbox"/> Made in China <input type="checkbox"/> No " Made in China " found <input type="checkbox"/> Others
		ON: <input type="checkbox"/> Product <input type="checkbox"/> Outer carton <input type="checkbox"/> Inner carton <input type="checkbox"/> Color box <input type="checkbox"/> Poly-bag
11.	Cross trash bin logo on:	ON: <input type="checkbox"/> Product <input type="checkbox"/> Color box <input type="checkbox"/> Manual <input type="checkbox"/> Batteries
12.	Safety mark:	TYPE: <input type="checkbox"/> CE <input type="checkbox"/> GS <input type="checkbox"/> UL <input type="checkbox"/> CSA <input type="checkbox"/> ROHS <input type="checkbox"/> PCT <input type="checkbox"/> CCC <input type="checkbox"/> Other:
		ON: <input type="checkbox"/> Product <input type="checkbox"/> Color box <input type="checkbox"/> Manual <input type="checkbox"/> Poly-bag <input checked="" type="checkbox"/> Other: N/A
13.	Others:	N/A


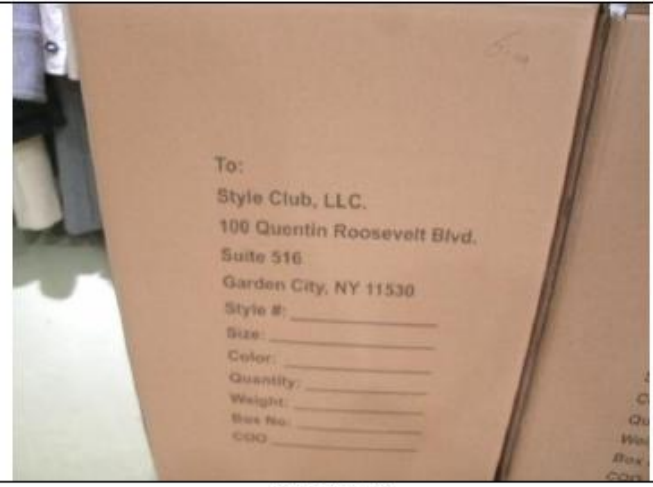
FOLLOW-UP ACTION :

PLEASE ADVISE	
<input type="checkbox"/> Issuance of certificate	<input type="checkbox"/> Re-FINAL charge will be covered by supplier
<input type="checkbox"/> Issuance of non-negotiable actual finding report	<input type="checkbox"/> Other
Your Comments.:	

Supplier	Inspector	Supervisor		Your Decision for the Inspection		
Mr. Zhao	Eric Zhang	<input type="checkbox"/> Dick F	<input type="checkbox"/> Mark W	<input type="checkbox"/> Agree with result <input type="checkbox"/> Conditional <input type="checkbox"/> Accept <input type="checkbox"/> Other	Customer Sign.	Sign. Date
		<input type="checkbox"/> Jeff L	<input type="checkbox"/> Allen G			
Our inspectors have notified supplier/factory not to effect shipment until get final approval from you.				Your Comments.:		

Factory's Co-operation	<input checked="" type="checkbox"/> Good	<input type="checkbox"/> Average	<input type="checkbox"/> Poor	<input type="checkbox"/> Very bad
Weather Conditions	<input type="checkbox"/> Sunny	<input checked="" type="checkbox"/> Cloudy	<input type="checkbox"/> Rainy	<input type="checkbox"/> N/A
Inspection Site	<input checked="" type="checkbox"/> QC Room	<input type="checkbox"/> Warehouse	<input type="checkbox"/> Workshop	<input type="checkbox"/> Harbor

PHOTO DOCUMENT

Photos for Products' Marking & Labeling & Packing	
Carton	
	
GEDC5647	GEDC5649



GEDC5650



GEDC5653



GEDC5654



GEDC5655




GEDC5662



GEDC5663



GEDC5664

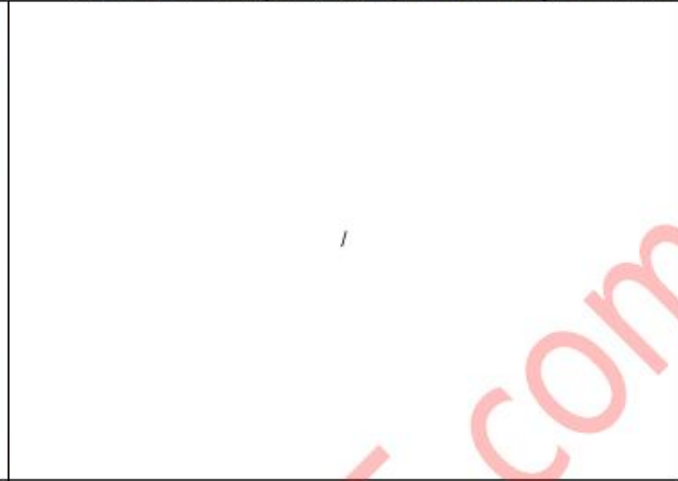

1-NR14-HD



GEDC5773



GEDC5774



GEDC5775



GEDC5776



GEDC5780



GEDC5781



GEDC5782



GEDC5787



GEDC5788



GEDC5789



GEDC5790



GEDC5791



GEDC5792



GEDC5793




GEDC5796



GEDC5798



GEDC5803

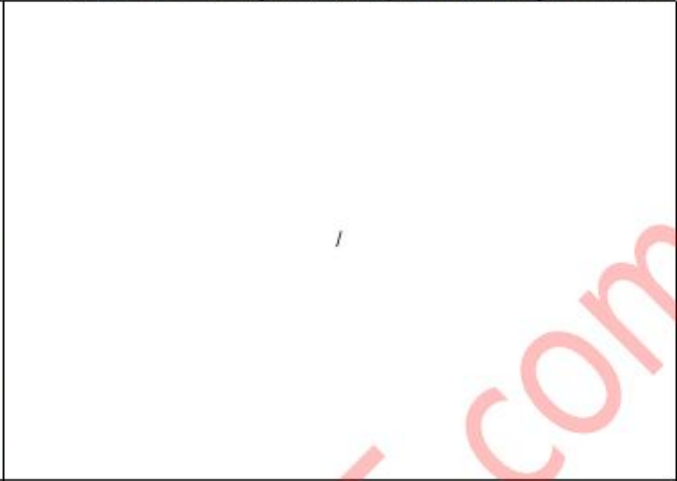

2-NR18-LI



GEDC5822



GEDC5823



GEDC5824



GEDC5825



GEDC5826



GEDC5827



GEDC5828



GEDC5831

3-NR27-HL



GEDC5809



GEDC5810



GEDC5811




GEDC5812



GEDC5813



GEDC5814

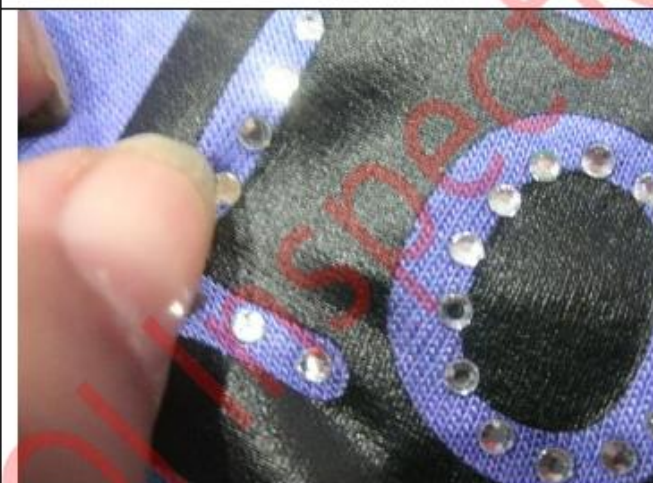

GEDC5815



GEDC5816



GEDC5817



GEDC5818

4-NRD17-AD



GEDC5751



GEDC5752



GEDC5753



GEDC5754



GEDC5755



GEDC5756



GEDC5757



GEDC5758



GEDC5759



GEDC5760



GEDC5761



GEDC5763



GEDC5783



5-NRSH22AD



GEDC5709



GEDC5710



GEDC5713



GEDC5714



GEDC5715



GEDC5716



GEDC5717



GEDC5721



GEDC5722



GEDC5723



GEDC5726



GEDC5736



GEDC5743



GEDC5745

6-NRSH44PP



GEDC5665



GEDC5666



GEDC5667



GEDC5668



GEDC5669



GEDC5672



GEDC5673



GEDC5677



GEDC5681



GEDC5685



GEDC5688



GEDC5690



GEDC5694



GEDC5695



GEDC5697



GEDC5703



GEDC5704



GEDC5705

others



GEDC5644



GEDC5645



GEDC5902



GEDC5903



GEDC5904



GEDC5905

P.O.#:	
Item No.:	4307 407 6154407/0071 46 405 21/001A 418/0022249
Product Description.:	top / shoes / dress
Inspection Area.:	Hong Kong
Quantity to be sealed. (PCS)	6
Remark:	
Signature (Inspector Name):	Mason
Inspection Date:	2011/06/01

GEDC5915



GEDC5916



GEDC5919



GEDC5920

End of the report